

Wet Pond Checklist

BMP Site Name: Davis Lake Charlotte

Date: 3/6/2014

Pond Name:

Item-by-Item Observation Key:

FF	Fully Functional (No Corrective Action Needed)
OWI	Operating with Issues (Suggested Corrective Action)
OWI-COR	Corrective Action Completed
NF	Not Functional (Corrective Action Needed)
NF-COR	Corrective Action Completed
MON	Monitor (Monitor for a period of time)
APP	Application
N/A	Not Applicable

INFLOW POINTS

Assessment	Status	Comments	Corrective Action
Obstruction: vegetation/debris/sediment	OWI	Sediment deposition in the head section and erosion at the newest inlet in the corner of the dam.	Mitigate sediment and repair erosion.
Erosion/undercutting	FF		
Displacement/sedimentation of fabric or rip-rap	OWI	Some erosion at inlet in the corner of the dam.	Repair eroded area.
Pipe condition	FF		
Other (Describe)			

FOREBAY (AS APPLICABLE)

Assessment	Status	Comments	Corrective Action
Sediment/debris accumulation	N/A		
Bare soil/erosion on side slopes	N/A		
Invasive vegetation	N/A		
Other (Describe)			

MAIN POND POOL AREA

Assessment	Status	Comments	Corrective Action
Visible pollution/muddiness of water quality,	FF		
Sediment accumulation	FF		
Trash accumulation	OWI-COR		Removed trash from pond.
Is vegetative shelf thriving? *	FF		
Invasive vegetation (%) *	FF		
Algae cover (%) *	FF		
Bare soil/erosion on side slopes	OWI	Area with bank sloughing and bare soil between gazebo and dam persists.	Repair bank sloughing and cover bare soil to prevent further erosion.

Side slopes maintained as mowed/covered	FF	Tall brush along many of the shorelines.	
Other (Describe)			

EMBANKMENT

Assessment	Status	Comments	Corrective Action
Bare soil, erosion, loss of dam material	OWI	Bare soil above the rip-rap on the dam.	Cover bare soil to prevent erosion.
Emergency spillway properly armored and free of woody vegetation	N/A		
Animal burrows	OWI	Muskrat damage persists.	Trap muskrats and repair damaged shorelines.
Signs of seepage on downstream face	FF		
Signs of structural failure: i.e., horizontal/vertical cracks	FF		
Upslope, top, and downslope mowed. Any shrubs/trees present (>3" tall)	MON	There are some trees along downslope side of dam/road.	
Other (Describe)			

OUTLET DEVICE

Assessment	Status	Comments	Corrective Action
Obstructed pipe, trash rack, or draw-down orifice	OWI-COR	Some debris on the outlet device.	Removed debris
Erosion/undercutting	FF		
Joint failure/loss of joint material, soil piping	FF		
Overall structural condition	FF		
Leaking devices	FF		
Sediment in Pipe	FF		
Displacement of fabric/rip-rap	FF		
Water level returns to normal pool (> 5 days after rainfall)	FF		
Other (Describe)			

WATER QUALITY

Parameter	Observations	Comments
Water Level	Mean Level	
Visibility (inches)	26	
Alkalinity (ppm)	32	
Hardness (ppm)	60	
pH	7.5	

Temperature (°F)	47	
------------------	----	--

MISCELLANEOUS

Assessment	Observations	Comments
Sequential BMP devices present (level spreader, grass swale, etc.)	<input type="checkbox"/>	
Access	Limited	Some areas are only accessible by boat and there is no made for purpose boat access.
Evidence of landscape maintenance being performed?	<input checked="" type="checkbox"/>	
Fence condition (if applicable)		
Fountain / Aerator / Diffused Air	<input type="checkbox"/>	
Fish Stocked	<input type="checkbox"/>	
Other (Describe)		1 dead largemouth bass found; cause of death unknown. There is a patch of burned grass on the dam.

ADDITIONAL COMMENTS / RECOMMENDATION:

Trap muskrats: this will likely be an activity that has to be done on at least an annual basis to reduce ongoing damage to the shorelines.